

Brushless Delvo C Series (Current control type)

Model **DLV04C/10C**

Four lessening settings con be set on one serewdriver!



delvo

MANUAL WORK RESET







- · Low-voltage Brushless Motor
- · ESD (Electro-Static Discharge) protection
- · For Both Hand-held / Automatic Machines
- Built-in Screw Counting Function















Four screwdrivers can be consolidated



Torque: 0.05 - 0.4 Nm (DLV04C)

0.2 - 1.0 Nm (DLV10C) [1.77 - 8.85 lbf · in]

Speed: 100 - 1000 min-1













Comparison of Adjustment Method with Conventional Model



Torque is adjusted by turning the adjustment ring at the end of the screwdriver.



Brushless Delvo C Series



Can be set with the external controller. No need to adjust the screwdriver body.

Conventional





The speed of transformerless type screwdrivers is fixed for each series.



Brushless Delvo C Series



Can be set with the external controller. Adjustable between 100 to 1000 min⁻¹.





Built-in Screw Fastening Counter Function

vacuum pickup (DLP6650).

For installation on automatic assembly machines, attach optional flange coupling (DLW9015) or

Controller has built in counting function. Prevents human errors.



Electric Current Control Function Explained







1 Start of fastening

At start-up, a small amount of current is allowed.

2 During fastening

As the load increases during fastening, so does the amount of current allowed.

3 End of fastening

When the desired current value (adjusted by corresponding torque value) is reached, current flow is cut off and the screwdriver stops.

Torque Measuring Equipment

Specifications of Electric Screwdriver and Controller

Model		DLV04C10L-AY K	DLV10C10L-AY K
Torque	SOFT fastening setting (1000 min ⁻¹ setting)	0.05 - 0.4 [0.44 - 3.54]	0.2 - 1.0 [1.77 - 8.85]
	SOFT fastening setting (600 min ⁻¹ setting)	0.05 - 0.35 [0.44 - 3.09]	0.2 - 0.45 [1.77 - 3.98]
(Nm [lbf·in])	HARD fastening setting	0.05 - 0.4 [0.44 - 3.54]	0.2 - 1.0 [1.77 - 8.85]
	SOFT fastening setting	600 - 1000	600 - 1000
	HARD fastening setting	100 - 1000	100 - 1000
Screw Size (mm)	Machine screw	1.2 - 3.0 [0.05" - 0.12"]	1.8 - 4.0 [0.07" - 0.16"]
	Tapping screw	1.1 - 2.5 [0.04" - 0.10"]	1.6 - 3.5 [0.06" - 0.14"]
Bit Type		NK35(OD6.35 mm [1/4"] Hex. Shank)	
Input Voltage		24 V DC	
Mass		0.37 kg [0.82 lbs]	
Rated Operation		ON: 0.5 seconds / OFF: 3.5 seconds	

nput Voltage Deration Channel Function Count Function Count Function Count Start up Control Function Count Signal Method Count Function Count Function Count Function Count Function Countrol Function Coun	Opositionis (Controller)				
Torque and speed setting in 4-channel memory Can switch to any operation channel Tracks screws fastened Workpiece detector can be incorporated External Start up Control Function Torque and speed setting in 4-channel memory Tracks screws fastened Workpiece detector can be incorporated External Start up Control Function Torque and speed setting in 4-channel memory Tracks screws fastened Workpiece detector can be incorporated External Start up control can be enabled by external input signal Torque and speed setting in 4-channel memory Tracks screws fastened Workpiece detector can be incorporated Torque and speed setting in 4-channel memory Tracks screws fastened Workpiece detector can be incorporated Torque and speed setting in 4-channel memory Tracks screws fastened Workpiece detector can be incorporated Torque and speed setting in 4-channel memory Tracks screws fastened Workpiece detector can be incorporated Torque and speed setting in 4-channel memory	Model	DCC0101X-AZ P			
Count Function Count Function Tracks screws fastened Workpiece detector can be incorporated External Start up Control Function Input Signal Method Control Function Tracks screws fastened Workpiece detector can be incorporated Function Photocoupler input	Input Voltage	AC100 - 240 V AC, 50/60Hz			
Count Function Tracks screws fastened Workpiece detector can be incorporated External Start up Control Function Input Signal Method Tracks screws fastened For processing the processing the start of the processing th	Operation Channel	Torque and speed setting in 4-channel memory			
Workpiece detector can be incorporated External Start up Control Function nput Signal Method Workpiece detector can be incorporated Start up control can be enabled by external input signal Photocoupler input	Function	Can switch to any operation channel			
Start up control can be enabled by external input signal nput Signal Method Photocoupler input	Count Function	Tracks screws fastened			
Control Function Start up control can be enabled by external input signal nput Signal Method Photocoupler input		Workpiece detector can be incorporated			
ontrol Function nput Signal Method Photocoupler input	External Start up	Start up control can be enabled by external input cignal			
	Control Function	Start up control can be enabled by external input signa			
(24 V DC drive (5 mA/1 input), respond to PNP output)	Input Signal Method	Photocoupler input			
		(24 V DC drive (5 mA/1 input), respond to PNP output)			
Dutput Signal Photocoupler output	Output Signal	Photocoupler output			
Method (30 V DC or less, 30 mA/1 output or less, PNP output method	Method	(30 V DC or less, 30 mA/1 output or less, PNP output method)			
Service Power Source 24 V DC (Maximum capacity 200 mA)	Service Power Source	24 V DC (Maximum capacity 200 mA)			
Power consumption When on standby: 20 W	Power consumption	When on standby: 20 W			
During electric screwdriver rotation (rated): 30 W	\ \ \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	During electric screwdriver rotation (rated): 30 W			
Mass 1.1 kg [2.4 lbs]	Mass	1.1 kg [2.4 lbs]			
Power cord (Optional) DLW9220 / DLW9240 / DLW9250	Power cord (Optional)	DLW9220 / DLW9240 / DLW9250			

Specifications (Controller)

Torque Checker	DLT1	173A
Measurement bit	NK35 (No.2 x 4 x 75)	
	 For the bit tip shape, use "+No.2" 	
Screw Joint for SOFT Fastening Setting*	DLW4540(with white rubber)	DLW4550(with black rubber)
Screw Joint for HARD Fastening Setting	DLW4560 (with metal washer)	
,		


^{*} Please use white rubber for DLV04C10L-AZ, black rubber for DLV10C10L-AZ measurement.

Caution

- · Speed and torque differs depending on the temperature. (Use within the range of +10 to +40 °C.)
- · Do not retighten screws that are already tightened. The torque will become larger than the set torque.
- · Please purchase the power cord for the controller separately (see page 5).
- · For torque measurements, please use Nitto Kohki's torque checker and screw joint (optional accessories).

LED Display of Electric Screwdriver and Controller

Notifies the OK or NG operation and settings by the LED lighting or blinking.

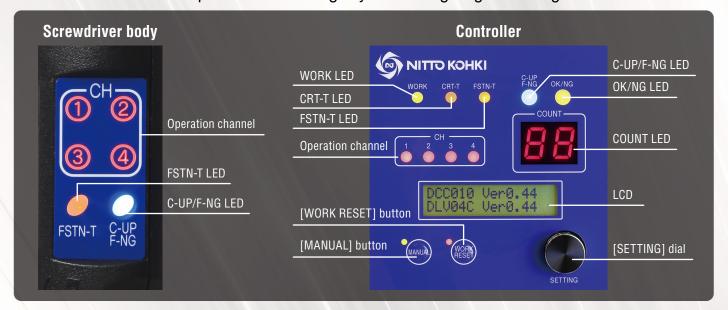

── LCD display

The status and setting content are displayed in the controller LCD.



Display example: Screw fastening mode (during SOFT setting)



Display example: Screw fastening mode (during HARD setting)

SOFT / HARD Fastening Settings

Two types of fastening mode available subject to the workpiece.

Coordinate the actual workpieces, screws and operating conditions and determine the fastening mode.


SOFT fastening setting

Suitable for workpieces with high fastening load such as tapping screws or fastening soft objects such as rubber.

HARD fastening setting

Suitable for workpieces with small fastening load such as threaded holes or rigid bodies such as metal.

Timing chart

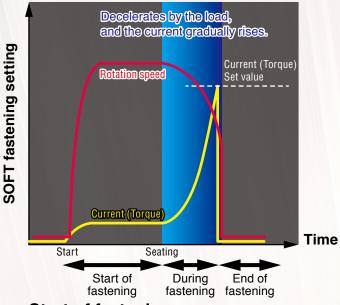

Start of fastening


After starting the screwdriver, it rotates at the set speed.

During fastening

As it screws in, the load gradually increases and the current value (torque) also rises.

End of fastening

When the screw is fastened completely and reaches the set current value (torque), the current will be cut off.

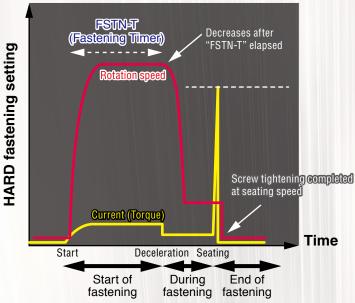

Start of fastening

After starting the screwdriver, it rotates at the set speed during FSTN-T (fastening timer) time.

During fastening

Fastens without load, and switches to the seating speed according to the torque set value just before seating the screw.


End of fastening

When the screw is fastened completely with the seating speed and reaches the set current value, the current will be cut off.


FSTN-T (Fastening Timer)


Can be set when "HARD" fastening setting is selected.

By increasing the rotation speed during no-load fastening time prior to seating, the overall fastening time is reduced.

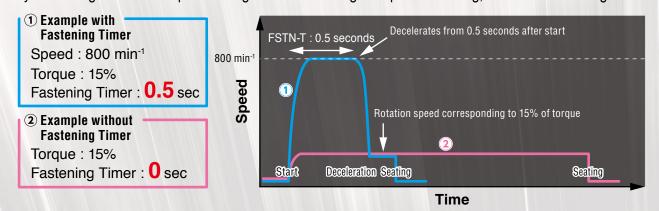

Graph of output torque and rotation speed

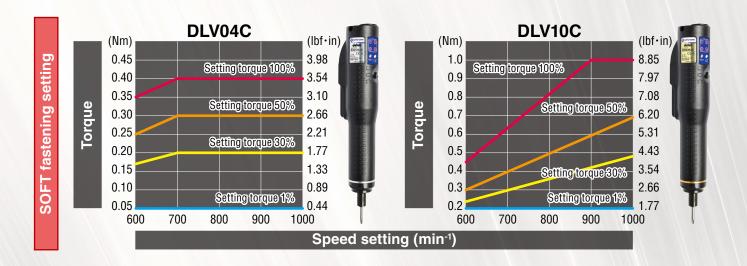

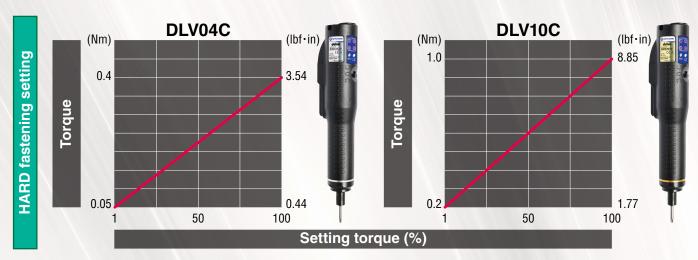

^{*}The graph is for guidance only. The output torque range is not guaranteed.

Optional Accessories


















External Signals

You can input or output external signals via a signal terminal block.



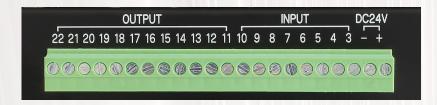

Terminal No.	Function	Details	I/O
1 (+)	+24 V DC	Built-in service power source (Capacity: Maximum 200 mA)	Service power
2 (-)	0 V DC	• Use in power source for input/output signal common wire, or for the workpiece detection sensor, etc.	source
3	Channel A	In the 2-bit input signal, specify the operation channel (CH1 to CH4) • Valid only when "operation channel switching method" (No.1 CH-CHG) is set to "INPUT"	
4	Channel B		
5	Forward rotation startup	Startup with external input cianal	
6	Reverse rotation startup	Startup with external input signal	
7	WORK	Input the workpiece signal (workpiece detection sensor output) • With "count function" (No.11 COUNT-FNC) and "workpiece signal" (No.12 WORK-SNSR) set to ON, the workpiece signal input is valid	Input
8	WORK RESET	Reset operation (same as controller [WORK RESET] button	
9	Keylock	Lock the controller button operation • Disable the controller button operation, and prevent setting changes by the operator	
10	Input signal negative	Connect 0 V DC* • Service power source (terminal No.2) or external 0 V DC power source can be connected	
11	Forward rotation signal	Set output signal during forward rotation to ON	
12	Reverse rotation signal	Set output signal during reverse rotation to ON	
13	Count-up (C-UP)	Performance of normal screw tightening (torque-up) sets output signal to 0.3 seconds ON	
14	Screw fastening NG (F-NG)	If screw fastening NG, sets output signal to 0.3 seconds ON	
15	Operation channel 1 (CH1)	Trouble in the control of the contro	
16	Operation channel 2 (CH2)		
17	Operation channel 3 (CH3)	Set the channel output signal to ON during operation or settings	Output
18	Operation channel 4 (CH4)		
19	Operation OK	If the set count screw tightening is judged to be completed and operation OK, the output signal is set to ON When the WORK input signal is OFF during an operation, and the operation is judged to be NG, the output signal is ON	
20	Operation NG		
21	Space	Connection impossible	
22	Output signal positive common wire	tput signal positive Connect +24 V DC*	


*When PNP output


Optional Accessories







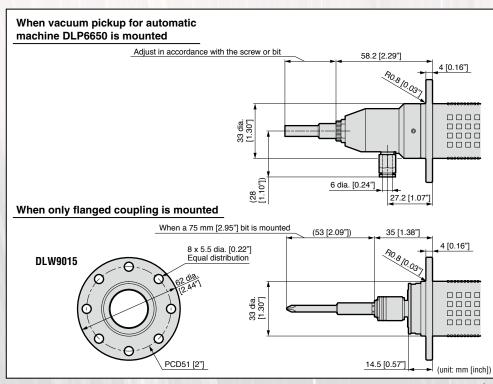

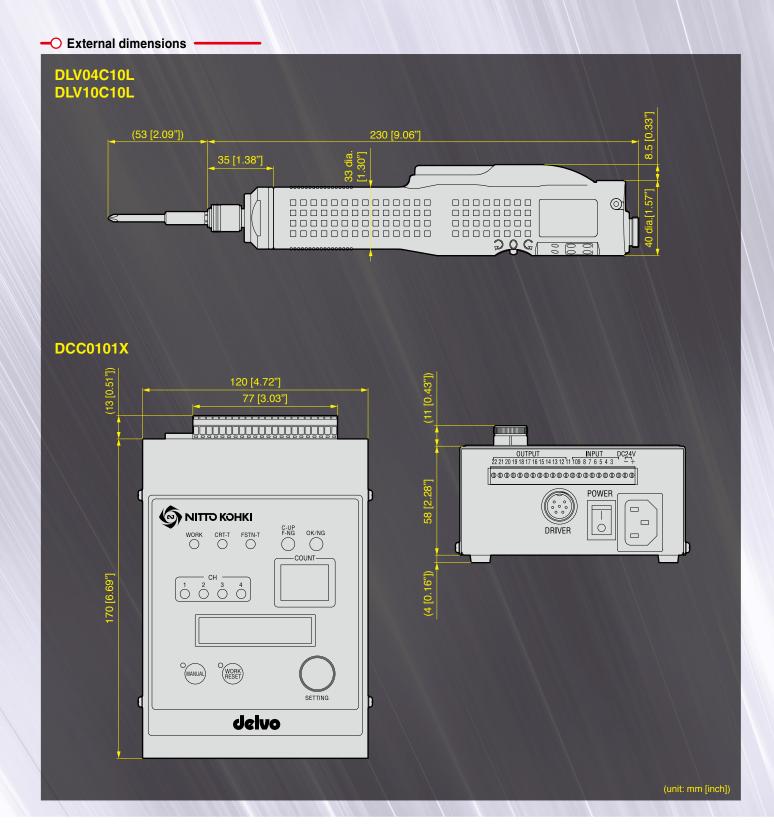

Focused on you

NITTO KOHKI CO., LTD.

Web www.nitto-kohki.co.jp/e

Head Office

9-4, Nakaikegami 2-chome, Ohta-ku, Tokyo 146-8555, Japan

Tel: +81-3-3755-1111 Fax: +81-3-3753-8791

E-mail: overseas@nitto-kohki.co.jp

DISTRIBUTED BY